Ultrasonic Diffuse, Analogue and Digital Output Types UA30CAD60....TI





- Cylindrical M30 with Ø40 front and PBT housing
- Sensing distance: 350-6000 mm
- Power supply: 12 (15) to 30 VDC
- Outputs: 0-10 VDC or 4-20 mA and one switching output NPN or PNP.
- Linearity error 1%
- Repeatability 1%
- Beam angle. ±7°
- Protection: Short-circuit, reverse polarity and overvoltage
- Protection degree IP 67, Nema 4X
- 2 m cable or M12 plug



Product Description

A family of diffuse ultrasonic sensors with sensing ranges from 350-6000 mm with a resolution as low as 15 mm. The sensor contains both an analogue and a digital output. The output is either 0-10V or 4-20 mA and the digital output NPN or PNP, NO or NC which forms a windows detection.

The sensor is the ideal choice for distance measurement, level measurement, diameter measurement or loop control. Due to use of microprocessor control the digital filtering makes the sensor immune to most electromagnetic interferences.

Ordering Key

Ultrasonic sensor

Housing style

Housing size — Housing material

Output type

Connection Teach-in —

Housing length — Detection principle

Sensing distance

Output configuration

UA30CAD60NGM1TI

Type Selection

Housing diameter	Connec- tion	Rated operating dist. (S _n)	Analog Output	Digital output NPN/PNP	Ordering no.
M30	Plug M12	350-6000 mm	4-20 mA	NPN	UA 30 CAD 60 NG M1 TI
M30	Cable	350-6000 mm	4-20 mA	NPN	UA 30 CAD 60 NG TI
M30	Plug M12	350-6000 mm	0-10 V	NPN	UA 30 CAD 60 NK M1 TI
M30	Cable	350-6000 mm	0-10 V	NPN	UA 30 CAD 60 NK TI
M30	Plug M12	350-6000 mm	4-20 mA	PNP	UA 30 CAD 60 PG M1 TI
M30	Cable	350-6000 mm	4-20 mA	PNP	UA 30 CAD 60 PG TI
M30	Plug M12	350-6000 mm	0-10 V	PNP	UA 30 CAD 60 PK M1 TI
M30	Cable	350-6000 mm	0-10 V	PNP	UA 30 CAD 60 PK TI

Specifications

Rated operating distance (S _n)	Reference target: 1 mm metal rolled finish, size 200 x 200 mm 350 - 6000 mm
Blind zone	≤ 350 mm
Repeatability	1%
Linear Accuracy	1%
Beam angle	±7°
Sensitivity Push-button Resolution	P1 (longest setpoint) P2 (shortest setpoint) 2 mm
Temperature drift	±5%
Temperature compensation	Yes

Hysteresis (H) Rated operational voltage (U _B) NG or PG versions NK or PK versions	Min. 2.0% 12 to 30 VDC 15 to 30 VDC (ripple included)
Ripple (U _{rpp})	≤ 5%
No-load supply current (I _o)	50 mA @ U _B max
Output current continuous digital output (I _e) Max. load capacity 100 nF	300 mA
Output current short-time digital output (I) Max. load capacity 100 nF	300 mA
Minimum operational current digital output (I_m)	0.5 mA
OFF-state current digital	




Specifications (cont.)


output (l _,)	10 μΑ				
Voltage drop digital output (U _d) ≤ 2.2 VDC @ 100 mA					
Protection					
Digital output	Short-circuit, overvoltage				
Supply	pulses and reverse polarity Overvoltage pulses and reverse polarity				
Analogue output	Overvoltage pulses				
Analog output NG or PG types NK or PK types	4 to 20 mA (Load \leq 500 Ω) 0 to 10 VDC (Load \geq 3 kΩ)				
	75 kHz				
Carrier frequency	75 KHZ				
Operating frequency digital output (f)	≤ 1 Hz				
Response time OFF-ON digital output (t_{ON})	≤ 500 mS				
Response time ON-OFF digital output (t_{OFF})	≤ 500 mS				
Power ON delay	300 mS				
Output function, open collector By sensor type	NPN or PNP				
Output switching function	One open collector transistor and one analogue output to be configured as: - Windows function with N.O or N.C. output. - Analogue output with positive or negative slope.				
Indication Output ON	Yellow LED				

Echo received Environment	Green LED
Installation category	III (IEC 60664/60664A; 60947-1)
Pollution degree	3 (IEC 60664/60664A; 60947-1)
Degree of protection	IP67 (IEC 60529; 60947-1) Nema 4X
Ambient temperature	
Operating	-20° to +70°C (-4° to +158°F)
. 0	
Storage	-35° to +70°C (-31° to +158°F)
Vibration	10 to 55 Hz, 1.0 mm/6G. (IEC/EN 60068-2-6)
Shock	30 g / 11 mS, 3 directions (IEC/EN 60068-2-27)
Rated insulation voltage	< 500 VAC (rms)
Housing	
Material body	PBT
Material front	Epoxy-glass resin
Material back, plug	Grilamid
Material back, cable	Grilamid
Material push-button	TPF
Sealing around push-button	TPF
Material sealing front	TPE
Connection	11 2
Cable	DVC area or
Cable	PVC, grey, 2 m,
Dive	$4 \times 0.34 \text{ mm}^2$, $\emptyset = 4.7 \text{ mm}$
Plug	M12, 4-pin (CON. 14-series)
Tightening torque	≤ 1.5 Nm
Weight	
Cable version	200 g
Plug version	130 g
CE-marking	Yes

Wiring Diagram

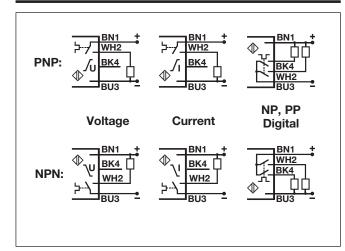


Detection Range

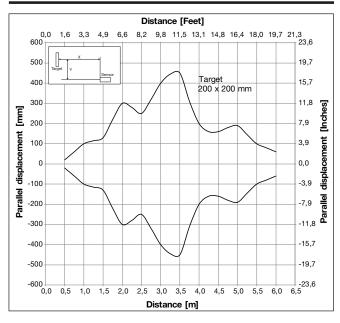



Dimensions

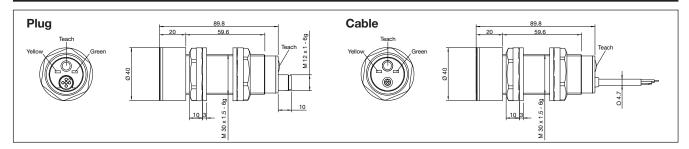


Programming setup

General set up of sensing point P1 (longest distance) and Shortest distance (P2) independent of the sensor type or function.


- 1) Mount the sensor in the selected application
- 2) Place a target in front of the sensor at the maximum required distance (P1), then press shortly on the teach-button, the yellow LED switches Off and then On again after a maximum of 2 seconds. The distance (P1) is now saved in the sensor and the target can be moved. I)
- 3) Place the target at the minimum distance requested (P2), then press shortly on the teach-button. The yellow LED turns Off and then it flashes 5 times. The distance (P2) is now saved in the sensor and the target can be moved. II)
 - I) P1 can be set to a maximum exceeding the family specification for the sensor by removing the target in front of the sensor. Push and hold the teach-button more than one second and the sensing distance is set at a unique distance for this sensor only. Do not use this function for an analogue output.
 - II) The second switch point can be set to a minimum by placing the target within the blind zone close to the sensor head or by covering the sensor head with your hand while teaching P2.

Sensors with one digital output and one analogue output UA..CAD..PG/PK/NG or NK types

1) The factory setting is Normally Open (N.O.) for the digital output and positive slope for the analogue output.




2) To reverse the slope to negative and reverse the N.O. output to Normally Closed (N.C.), push the teach-button for 8 seconds until the yellow LED flashes fast. Release the teach button and the LED will flash 5 times to acknowledge the change in function.



3) To switch back to positive slope or N.O. output, repeat step 2.



Installation Hints

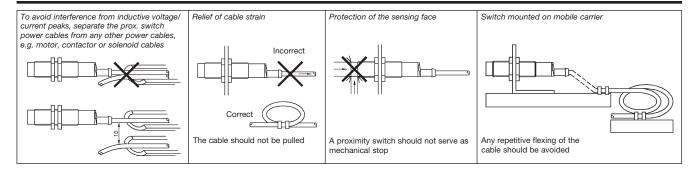

Delivery Contents

- Ultrasonic sensor: UA30CAD60..
- Installation instruction
- Mounting:
 - 2 x M30 Nuts
 - 2 x rubber washers
- Packaging: Carton box 54 x 107 x 173 mm

Accessories

• Connector type CONM14NF.. series